



SERVICE BULLETIN

DATE: 19 JULY 1995

PAGE 1 OF 3

/// MANDATORY ////////////////////////////////////// MANDATORY ////////////////////////////////////// MANDATORY ///

APPLICATION OF COLLECTIVE CONTROL INDEX MARK

1. PLANNING INFORMATION:

A. Aircraft Affected:

All McDonnell Douglas Helicopter Systems (MDHS) MD900 helicopters, serial number 900-00010 thru 900-00034.

B. Assembly/Components Affected by this Notice:

Collective Control Module, P/N 900C3010050-107.

C. Reason:

Required modification of the Collective Control Module (P/N 900C3010050-107). This modification consists of applying an additional index mark to the control module, in clear view of the pilot, to assist the pilot in locating the throttle normal operation detent position and twist grip alignment.

D. Description:

This Bulletin describes procedures to apply an index mark to the Collective Control Module.

E. FAA Approval:

The design engineering aspects of this Bulletin have been shown to comply with the applicable Federal Aviation Regulations and are FAA Approved.

F. Manpower:

One man/hour.

G. Time of Compliance:

The requirements of this Bulletin shall be accomplished within the next 300 hours of helicopter operation or at the next annual inspection, whichever occurs first.

H. Interchangeability:

N/A.

I. Material/Part Availability:

N/A.

REPLACEMENT PARTS/SUPPLIES			
Nomenclature	Part No.	Qty.	Source
Paint, White	FED-STD-595, No. 17875		Commercial

J. Warranty Policy:

N/A.

/// MANDATORY ////////////////////////////////////// MANDATORY ////////////////////////////////////// MANDATORY ///



DATE: 19 JULY 1995

PAGE 2 OF 3

SERVICE BULLETIN

/// MANDATORY ////////////////////////////////////// MANDATORY ////////////////////////////////////// MANDATORY ///

K. Weight and Balance:

Not affected.

L. Electrical Load Data:

Not affected.

2. ACCOMPLISHMENT INSTRUCTIONS:

- (1). Paint a triangle shaped index mark in location shown on Figure 1 with white paint per FED-STD-595, No. 17875.
- (2). After the white paint has dried, apply a clear protective coating over the index mark.

3. COMPLIANCE RECORD:

- (1). Record compliance to this Service Bulletin in the Compliance Record section of the helicopter Log Book.

4. POINTS OF CONTACT:

For further assistance, contact your local MDHS Field Service Representative (refer to the latest revision of the Business Development and Customer Support handbook for address and telephone numbers) or contact the Field Service Department at MDHS, Mesa Arizona. Telephone: 1-800-388-3378 or (602) 891-6342. DATAFAX: (602) 891-6782.


/// MANDATORY ////////////////////////////////////// MANDATORY ////////////////////////////////////// MANDATORY ///

SERVICE BULLETIN

DATE: 19 JULY 1995

PAGE 3 OF 3

MANDATORY

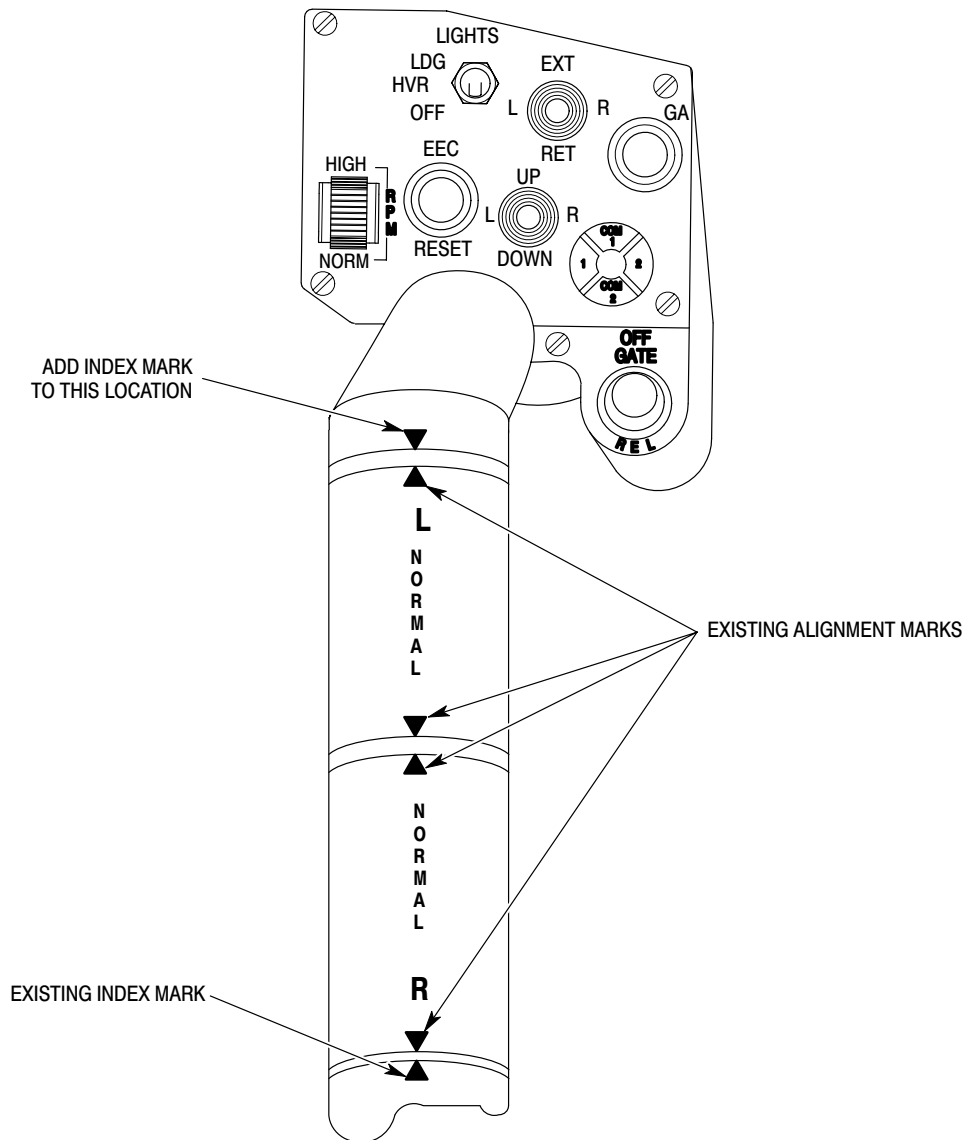

9B67-004

Figure 1. Application of Index Mark to Collective Control Module

MANDATORY